




# SAFETY INFORMATION

10/8

## DAMAGE TO SUSPENSION LINES

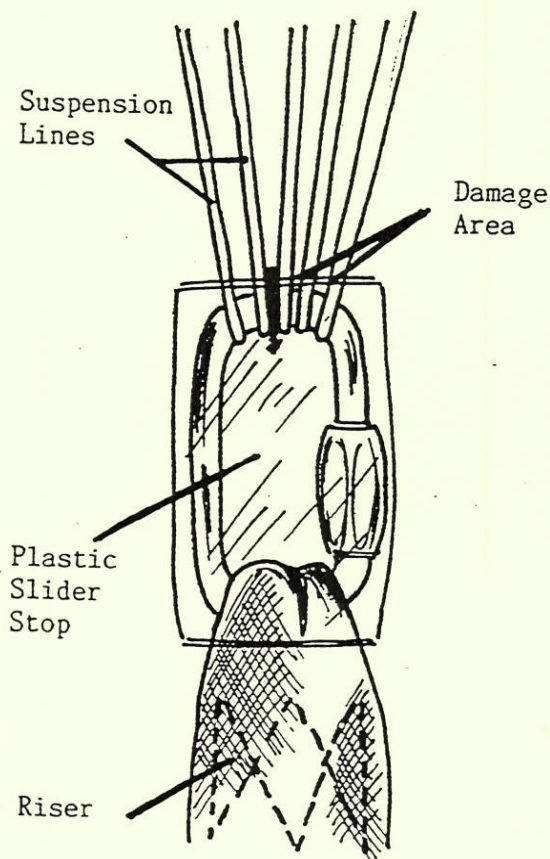

It has come to our attention that some canopies are suffering damage to suspension lines, particularly canopies with micro-line. The damage is occurring near the attachment point to the connector link or level with the slider stops.

Possible causes:

1. Friction on slider stops when lines are spread.
2. Slider vibrating causing friction between slider grommet and lines.

This should be checked at each repack.

Feed-back to the office would be appreciated.

John Hitchen  
JOINT NATIONAL COACH AND SAFETY OFFICER

28th November 1989

### Distribution:

C.C.I.s  
Advanced Riggers  
Steve Eversfield.